

1. CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

Product Name: QUANTUM UV URETHANE VARNISH CLEAR SATIN BASE Product Code: 99-ST-SATIN

MANUFACTURER:

Engineered Marine Coatings, Inc.
2134 Cainhoy Rd
Huger, SC 29450 United States
T 855-544-3648

EMERGENCY PHONE: 1-800-255-3924 (CHEMTEL)

E ask@quantumpaint.com www.quantumpaint.com

Product Use: FOR PROFESSIONAL USE ONLY

2. HAZARD(S) IDENTIFICATION

GHS Ratings:

Flammable liquid	3	Flash point $\geq 23^{\circ}\text{C}$ and $\leq 60^{\circ}\text{C}$ (140°F)
Inhalation Toxicity	Acute Tox. 1	Gases $\leq 100\text{ppm}$, Vapors $\leq 0.5\text{mg/l}$, Dusts&mists $\leq 0.05\text{mg/l}$
Skin corrosive	3	Reversible adverse effects in dermal tissue, Draize score: $\geq 1.5 < 2.3$
Eye corrosive	2	Eye Irritation: Reversible adverse effects on cornea, iris, conjunctiva, Draize score: Corneal opacity ≥ 1 , Iritis > 1 , Redness ≥ 2 , Chemosis ≥ 2
Skin sensitizer	1	Skin sensitizer
Carcinogen	2	Limited evidence of human or animal carcinogenicity

GHS Hazards

H226	Flammable liquid and vapour
H316	Causes mild skin irritation
H317	May cause an allergic skin reaction
H330	Fatal if inhaled
H351	Suspected of causing cancer

GHS Precautions

P201	Obtain special instructions before use
P202	Do not handle until all safety precautions have been read and understood
P210	Keep away from heat/sparks/open flames/hot surfaces - No smoking
P233	Keep container tightly closed
P240	Ground/bond container and receiving equipment
P241	Use explosion-proof electrical/ventilating/light/.../equipment
P242	Use only non-sparking tools
P243	Take precautionary measures against static discharge
P260	Do not breathe dust/fume/gas/mist/vapours/spray
P261	Avoid breathing dust/fume/gas/mist/vapours/spray
P264	Wash hands thoroughly after handling
P271	Use only outdoors or in a well-ventilated area
P272	Contaminated work clothing should not be allowed out of the workplace

P280	Wear protective gloves/protective clothing/eye protection/face protection
P281	Use personal protective equipment as required
P284	Wear respiratory protection
P310	Immediately call a POISON CENTER or doctor/physician
P320	Specific treatment is urgent (see ... on this label)
P321	Specific treatment (see precautionary statements on this label)
P363	Wash contaminated clothing before reuse
P302+P352	IF ON SKIN: Wash with plenty of soap and water.
P303+P361+P353	IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower.
P304+P340	IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing.
P305+P351+P338	IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing
P308+P313	IF exposed or concerned: Get medical advice/attention.
P332+P313	If skin irritation occurs: Get medical advice/attention.
P333+P313	If skin irritation or rash occurs: Get medical advice/attention.
P337+P313	If eye irritation persists: Get medical advice/attention.
P370+P378	In case of fire: Use dry sand, dry chemical or alcohol-resistant foam for extinction.
P405	Store locked up
P403+P233	Store in a well ventilated place. Keep container tightly closed
P403+P235	Store in a well-ventilated place. Keep cool.
P501	Dispose of contents/container to an approved waste disposal plant.

Signal Word: **Danger**



3. COMPOSITION/INFORMATION ON INGREDIENTS

Chemical Name	CAS number	Weight Concentration %
Propylene Glycol Monomethyl Ether Acetate	108-65-6	10.00% - 20.00%
Dimethyl Carbonate	616-38-6	10.00% - 20.00%
Methyl Isobutyl Ketone	108-10-1	1.00% - 5.00%
Butyl Acetate	123-86-4	1.00% - 5.00%
Xylene	1330-20-7	1.00% - 5.00%
pentane-2, 4-dione	123-54-6	1.00% - 5.00%
Ethylbenzene	100-41-4	0.10% - 1.00%

4. FIRST AID MEASURES

INHALATION:

Move to an area free from risk of further exposure. Administer oxygen or artificial respiration as needed. Obtain medical attention. Asthmatic-type systems may develop and may be immediate or delayed up to several hours. Treatment is essentially symptomatic. Consult a physician.

EYES:

Flush with clean, lukewarm water (low pressure) for at least 15 minutes, while lifting eyelids. Refer individual to physician or ophthalmologist for immediate follow-up.

SKIN:

First aid for skin: Remove contaminated clothing immediately. Wash affected areas thoroughly with soap and water. Wash contaminated clothing thoroughly before reuse. For severe exposures, get under safety shower after removing clothing, then get medical attention. Seek medical attention if irritation develops or persists.

INGESTION:

DO NOT INDUCE VOMITING. Give 1 to 2 cups of mil or water to drink. DO NOT GIVE ANYTHING BY MOUTH TO AN UNCONSCIOUS OR CONVULSING PERSON. Consult physician immediately.

5. FIRE FIGHTING MEASURES

Flash Point: 27 C (81 F)

LEL: 1.00

UEL: 13.00

EXTINGUISHING MEDIA:

Use water spray to cool fire exposed surfaces and to protect personnel. Isolate "fuel" supply from fire. Use foam, dry chemical, carbon dioxide, or water spray as last option. Avoid spraying water directly into storage containers due to the danger of boilover.

HAZARDOUS COMBUSTION PRODUCTS:

Fires involving this product may release fumes, smoke, carbon dioxide, carbon monoxide, and irritating vapors.

FIRE FIGHTING INSTRUCTIONS:

Wear self-contained breathing apparatus and protective clothing. Use water spray to keep fire-exposed containers cool. Water may be ineffective in fighting fire. Vapors may cause a flash fire or ignite explosively. Either the liquid or vapor may settle in low areas or travel some distance along the ground or surface to ignition sources where they may ignite or explode.

6. ACCIDENTAL RELEASE MEASURES

SMALL SPILL:

Eliminate all ignition sources. Absorb spill with vermiculite or other inert material, then place in a container for chemical waste.

LARGE SPILL:

Evacuate all non-essential personnel. Remove all sources of ignition. Ventilate the area. Equip employees with appropriate protection equipment. Dike around spilled material. Cover spill with inert absorbent material and shovel with non-sparking tools into container. Remove containers to a safe area and seal. Waste material must be disposed of in accordance with federal, state, and local environmental regulatory controls.

7. HANDLING AND STORAGE

HANDLING:

Ground lines and equipment during transfer to reduce the possibility of static spark-initiated fire or explosion. Use non-sparking tools. Do not cut, grind, drill, weld, or reuse containers unless adequate precautions are taken against these hazards. Do not eat, drink, or smoke in areas of use or storage.

STORAGE:

Protect against physical damage. Store in a cool dry place. Outside or detached storage preferred. Inside storage should be in a standard flammable liquid storage room or cabinet. All equipment should be grounded and bonded to reduce static electricity hazard. Use non-sparking tools. Do not reuse empty product container for any purpose.

8.EXPOSURE CONTROLS/PERSONAL PROTECTION

Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Propylene Glycol Monomethyl Ether Acetate 108-65-6	OSHA PEL Not Available	ACGIH TLV Not Available	TWA 50 ppm USA. Workplace Environmental Exposure Levels (WEEL)
Dimethyl Carbonate 616-38-6	OSHA PEL Not Available	ACGIH TLV Not Available	Not Established
Methyl Isobutyl Ketone 108-10-1	The OSHA TWA is 100 ppm (410 mg/m3).	NIOSH and ACGIH recommend a TWA of 50 ppm (205 mg/m3) and STEL of 75 ppm (300 mg/m3).	Not Established
Butyl Acetate 123-86-4	TWA 150 ppm 710 mg/m3 USA. OSHA - TABLE Z-1 Limits for Air Contaminants - 1910.1000	n-Butyl and isobutyl acetates have a Federal and ACGIH limit of 150 ppm (710 mg/m3) TWA. sec-butyl and tert-butyl have a Federal and ACGIH limit of 200 ppm (950 mg/m3) TWA.	Not Established
Xylene 1330-20-7	PEL 100 ppm - TWA STEL 150 ppm (655 mg/m3) TWA 100 ppm (435 mg/m3) USA. OSHA - TABLE Z-1 Limits for Air Contaminants -1910.1000	100 ppm - TWA 150 ppm - STEL	Not Established
pentane-2, 4-dione 123-54-6	OSHA PEL Not Available	ACGIH TLV Not Available	Not Established
Ethylbenzene 100-41-4	100 ppm TWA 125 ppm STE	100 ppm TWA 125 ppm STEL	The NIOSH IDLH level is 800 ppm of 0.02 mg/m3 on either a momentary or a daily average basis.

Ventilation:

Good general ventilation (typically 10 air changes per hour) should be used to keep vapor levels below the limits in Section 2 and lower explosive limit in Section 5. Ventilation rates should be matched to conditions. Use process enclosures, local exhaust ventilation, or other engineering controls to maintain airborne levels below recommended exposure limits.

Respiratory Protections:

Respirator Requirements - A respirator that is recommended or approved for use in isocyanate containing environments (air purifying or fresh air supplied) may be necessary for spray applications or other situations such as high temperature use. This may cause inhalation exposures. A supplied air respirator (either positive pressure or continuous flow type) is recommended before an air-purifying respirator can be used. Air monitoring must be performed to measure airborne concentrations of HDI monomer, HDI polyisocyanate and organic solvents. See the outline below for the specific conditions under which air-purifying respirators can be used. Observe OSHA regulations for respirator use (29 CFR 1910.134)

Spray Application:

A. Good industrial hygiene practice dictates that when isocyanate based coatings are spray applied, some form of respiratory protection should be worn. During the spray application of organic solvent containing coatings systems, the use of a supplied-

air (either positive pressure or continuous flow type) respirator is mandatory when one or more the following conditions exists:

The airborne isocyanate concentrations are not known; or

-the airborne isocyanate monomer concentrations exceed 0.05 ppm (10 times TLV); or

-The airborne polyisocyanate (polymer, oligomeric) concentrations exceed 5 mg/m3 averaged over 8 hours or mg/m3 averaged over 15 minutes (10 times the mgl);or

-No airborne solvent concentration exceeds its odor threshold;or

-Spraying is performed in a confined space (See OSHA Confined Space Standard 29 CFR 1910.146).

A properly fitted air-purifying (combination organic vapor and particulate) respirator, proven by test to be effective in isocyanate-containing spray painting environments, and used in accordance with all recommendations made by the manufacturer, can be used when all of the following conditions are met:

-The airbrone isocyanate monomer concentrations are known to be below 0.05 ppm (10 times the TLV); and

-The airborne polyisocyanate (polymer, oligomeric) concentrations exceed 5 mg/m3 averaged over 8 hours or mg/m3 average over 15 minutes (10 times the mgl);and

-At least one solvent has a published odor threshold; and

-At least one airborne solvent concentration exceeds its odor threshold and that solvent's odor is lower than its TLV .

B. During the spray application of a coating system not containg organosolvents a supplied-air (either positive pressure or continuous flow type) respirator is mandatory when one or more of the following conditions exist:

-The airborne isocyanate concentrations are not known; or

-The airborne polyisocyanate (polymer, oligomeric) concentrations exceed 5 mg/m3 averaged over 8 hours or mg/m3 average over 15 minutes (10 times the mgl);and

-Spraying is performed in a confined space (See OSHA Confined Space Standard 29 CFR 1910.146).

Under any other circumstances, during spray application of a coating system not containing organic solvents, good industrial hygiene practice dictates that when isocyanate based coatings are spray applied at least an air purifying respirator should be worn.

Non-Spray Operations:

A. During non-spray operations such as mixing, batch making, brush or roller applications, etc. at elevated temperatures (for example, heating of a material or application to a hot substrate), it is possible to be exposed to airborne isocyanate vapors.

Therefore, when the coatings system contains solvents and will be applied in a non-spray manner, a supplied-air (either positive presure or continuous flow type) respirator is mandatory using the guidelines in the previous section for spray applications.

Contaminated Gear:

Promptly remove clothing that becomes contaminated. Provide readily accessible eye wash stations and safety showers. Wash at the end of each work shift and before eating, smoking or using the toilet.

9. PHYSICAL AND CHEMICAL PROPERTIES

This mixture typically exhibits the following properties under normal circumstances:

Appearance: Translucent Liquid	Odor: Solvent
Vapor Pressure: 42.2 hPa at 160C	Odor threshold: No Data
Vapor Density: 3.9	pH: No Data
Specific Gravity: 1.09	Melting point: No Data
Freezing point: No Data	Solubility: No Data
Boiling range: No Data	Flash point: 81°F,27°C
Evaporation rate: No Data	Flammability: Flammable Liquid, Class 2
Explosive Limits: 1% - 13%	Partition coefficient (n-octanol/water): No Data
Autoignition temperature: No Data	Decomposition temperature: No Data
Coating VOC (lbs/gal) 3.43	

10. REACTIVITY AND STABILITY

STABLE

Incompatability:

Strong oxidizing agents
Strong Acids

May form explosive peroxides

Hazardous Decomposition:

May form: carbon dioxide and carbon monoxide
Hazardous polymerization will not occur.

11. TOXICOLOGICAL INFORMATION

Mixture Toxicity

Inhalation Toxicity LC50: 0mg/L

Component Toxicity

N/A

ROUTES OF ENTRY:

Inhalation Skin Contact Eye Contact Ingestion

Exposure to this material may affect the following organs:

Eyes Kidneys Liver Lungs Central Nervous System Reproductive System Skin

Effects of Overexposure

Short Term Exposure

Ethyl benzene irritates the eyes, skin, and respiratory tract. Exposure to high concentrations can cause dizziness, lightheadedness and unconsciousness. Very high exposures (above the OEL) can cause difficult breathing, narcosis, coma, and even death. Swallowing the liquid may cause aspiration into the lungs, resulting in chemical pneumonitis. May affect the central nervous system. Concentration of 200 ppm can cause irritation. The substance irritates the eyes, skin, and respiratory tract. High exposures, above the occupational exposure levels, can cause weakness, headache, and drowsiness and may cause unconsciousness. Methyl isobutyl ketone can affect you when breathed in. Exposure to high concentrations can cause you to feel dizzy and lightheaded and to pass out. Breathing the vapor may cause loss of appetite, nausea, vomiting, and diarrhea. Contact or the vapor can irritate the eyes, nose, mouth, throat. Contact can irritate the skin. Ingestion chemical pneumonitis.

Long Term Exposure

Repeated or prolonged exposure to the skin may cause drying, scaling and blistering. May cause kidney disease, liver disease, chronic respiratory disease, skin disease, as follows: EB is not nephrotoxic. Concern is expressed because the kidney is the primary route of excretion of EB and its metabolites. EB is not hepatotoxic. Since EB is metabolized by the liver, concern is expressed for these tissues. Exacerbation of pulmonary pathology might occur following exposure to EB. Individuals with impaired pulmonary function might be at risk. EB is a defatting agent and may cause dermatitis following prolonged exposure. Individuals with preexisting skin problems may be more sensitive to EB. There is limited evidence that EB may damage the developing fetus, and may cause mutations. n-Butyl acetate may cause skin allergy. n-Butyl acetate has been shown to damage the developing fetus in animals. Prolonged and repeated exposure to butyl acetates can cause defatting, drying and cracking of the skin. Although many solvents and petroleum based products cause lung, brain and nerve damage, these chemicals have not been adequately evaluated to determine these effects. Long-term exposure may damage the liver and kidneys. Repeated or prolonged contact with skin may cause drying and cracking.

<u>CAS Number</u>	<u>Description</u>	<u>% Weight</u>	<u>Carcinogen Rating</u>
100-41-4	Ethylbenzene	.1 to 1.0%	California Proposition 65 The IARC has classified ethylbenzene as a possible carcinogen.

12. ECOLOGICAL INFORMATION

This section will be updated as ecological reviews are complete.

Component Ecotoxicity

13. DISPOSAL CONSIDERATIONS

Waste material must be disposed of in accordance with all federal, state, and local environmental regulatory controls. Chemical additions, processing, or otherwise altering this material may make the waste management information presented in this SDS incomplete, inaccurate, or otherwise inappropriate.

14. TRANSPORT

<u>Agency</u>	<u>Proper Shipping Name</u>	<u>UN Number</u>	<u>Packing Group</u>	<u>Hazard Class</u>
DOT	PAINT	1263	III	3

15. REGULATORY INFORMATION

The regulatory information provided is not meant to be comprehensive. Other federal, state, and local regulation applies to this material.

<u>Country</u>	<u>Regulation</u>	<u>All Components Listed</u>
----------------	-------------------	------------------------------

EU Risk Phrases

Safety Phrase

- None

16. OTHER INFORMATION


Hazardous Material Information System (HMIS)

HEALTH	<input type="text" value="2"/>
FLAMMABILITY	<input type="text" value="2"/>
PHYSICAL HAZARD	<input type="text" value="1"/>
PERSONAL PROTECTION	<input type="text" value="G"/>

HMIS & NFPA Hazard Rating Legend

- * = Chronic Health Hazard
- 0 = INSIGNIFICANT
- 1 = SLIGHT
- 2 = MODERATE
- 3 = HIGH

National Fire Protection Association (NFPA)

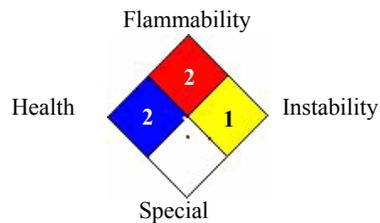

The information set forth above is based on information which Engineered Marine Coatings, Inc. believes to be accurate. No warranty, expressed or implied, is intended. The information is provided solely for your information and consideration and EMC assumes no legal responsibility for its use or reliance thereon.

Date revised: 2017-06-02

Reviewer Revision

Date Prepared: 6/2/2017